## DIVISION OF THE STATE FIRE MARSHALL BUREAU OF FIRE PREVENTION BOILER SAFETY PROGRAM

This inspection is intended for your safety and the safety of the citizens of Florida. Your cooperation is greatly appreciated.

## **Boiler - Fired Pressure Vessel report of Inspection**

Date Inspected <b>09/09/2021</b>			Follow Up I	Inspection			Nat'l Bd. No. Other No. 9964		
Owner	Owner Er	mail			Kind o	of Inspection	Cert Inspection		
Tailored Brands	mainten	nanceinvoices@tailoredbrands.			,	nt ✓Ext	☐ Yes ✓ No		
Owner Street Addre	Owner City				State	Zip			
6100 Stevenson	Fremont					94538-2490			
User Name - Object	Nature Of Business				Object Location	on - County			
Men's Wearhous	Retail				Hillsborough				
User Street Addres	User City					Zip			
8009 Citrus Park	Tampa				FL	33625-3001			
Type Electric	A	SME Code Stamp	Year Built <b>2006</b>	Manufacture Pacific	∍r				
Specific Location in			Method of Firing Pressure Gage Tested						
SHOP	i i idiit	Use <b>Process</b>		Fuel Electric		Electricity	illig		Yes No
Pressure This Insp	fety Relief V	/alves Set At Total Capacity				Heating Surface and/or BTU			
Allowed 100 psi 100 psi 100 psi 100 psi 423 LB/HR 61000 BTU/hr									U/hr
Is condition of object such that a certificate may be issued?								I DATE	□ Na
(If No, explain fully under condition)  Yes  No  Yes  PSI DAT  CONDITIONS: With respect to the internal surface, describe and state location of any scale, oil or other deposits. Give location									
Describe any adverse conditions with respect to pressure gage, water column, gage glass, gage cocks, safety valves, etc. Report conditions of setting, linings, baffles, supports, etc. Describe any major changes or repairs made since last inspection.  Boiler blow down line was leaking and to be replaced as was the sight glass and sight glass drain valve. Additional the high pressure control with manual reset was also leaking. All items to be addressed immediately by Florida boiler the repair company used at this location -they noted the repairs will be completed by 9/11/21. A follow up will follow once I am told the repairs are completed so the operating certificate can be renewed. – -FL 7.4.1 sight glass and sight glass drain valve leaking.  FL8.3.11 - Boiler bottom blow down line leaking.  FL8.4 - High pressure control with manual reset leaking.									
REQUIREMENTS: (List of Code Violations)  -1. Replace sight glass and drain valve.									
<ul><li>2. Replace bottom blow down piping as needed to restore to good operational condition.</li><li>3. Replace pressure control with manual reset with new.</li></ul>									
Name and Title of Person To Whom Requirements Were Explained Jamal Hussein - Mgr									
HEREBY CERTIF		E REPORT OF MY IN	SPECTION						
Inspector Name	V	Ident. No.			E	Employed By			Ident. No.
Lance Dietz		FL-1313 NB	-10240			XL Insurance	America	a, Inc.	30199785